

## Pit Filler Kit INSTRUCTIONS KIT1030



## After a windshield repair is complete, follow these steps to use the Pit Filler Kit:

1. Apply a drop of Pit Filler on the glass just above the pit and allow gravity to draw the Pit Filler into the pit. Make sure to maintain a slow flow into the pit, to keep air from becoming trapped.

Apply a Mylar® Sheet (HDW3000) over the Pit Filler: Start from the bottom edge of the sheet, to catch the Pit Filler moving down the glass. Continue applying the sheet so that the Pit Filler moves up and into the pit.

If needed, add more Pit Filler to ensure the pit is filled completely.

- 2. Cure the Pit Filler with a UV lamp. Curing takes 1-7 minutes, depending on the UV lamp used.
- 3. Remove the Mylar® sheet.
- 4. Use the Razor Blade to remove the excess Pit Filler, holding the blade at a 90° angle to the glass and sweeping the blade edge across the pit.
- 5. Polish the surface with supplied Pit Polish (LIQ2030) and a soft cloth (see Note).

**NOTE:** For additional polishing, use a buffing wheel (such as DRL2025, sold separately).

Designed for use after completion of a windshield repair, the Pit Filler Kit allows you to eliminate the pit that often remains on the surface of the glass at the impact point, resulting in a smooth finish. The included Pit Filler (LIQ2022) is ideal for filling surface pits – even the larger pits that create water trails during windshield wiper use.

## **CONTACT INFORMATION**

**AEGIS Tools International, Inc.** 

908 West Main St.

Laurel, MT 59044 USA

Email: contactus@wpg.com

Phone: (1) 800-548-7341 or (1) 406-628-8231

www.AegisTools.com

